- 303455

FAA-04-19221-2

N

-

./.

Bundesamt für Zivilluftfahrt (BAZL) **FOCA AD** Lufttüchtigkeitsanweisung (LTA) Office fédéral de l'aviation civile (OFAC) Consigne de Navigabilité (CN) Ufficio federale dell'aviazione civile (UFAC) Prescrizione di Aeronavigabilità (PA) Federal Office for Civil Aviation (FOCA) Airworthiness Directive (AD) HB-2004-330 Maulbeerstasse 9 CH-3003 Berne Switzerland Inkraftsetzung PILATUS - PC-12 Mise en vigueur 23 August 2004 Entrata in vigore FOCA TC/TCDS No: F56-30 ATA 32 - LANDING GEAR Effective Date

Issue date: 18 August 2004

Subject: MAIN LANDING GEAR ACTUATOR - Replacement

Superseded/Revised ADs: Not applicable

1. APPLICABILITY:

PILATUS AIRCRAFT LTD.

All Model PC-12 and PC-12/45 airplanes, Manufacturer Serial Numbers (MSN) 101 thru MSN 560 equipped with main landing gear (MLG) actuators Part Numbers (P/Ns): 960.30.01.103 with Serial Numbers (S/Ns): 830E thru 881E inclusive.

NOTE:

MLG-actuators P/N 960.30.01.103 with S/N 830E thru 881E inclusive where installed in PC-12 Series airplanes MSN 482 thru MSN 509 inclusive during manufacture. It is possible that these components could have been removed and then installed in other PC-12 or PC-12/45 airplanes.

2. REASON:

It has been found that some components of MLG actuators P/N 960.30.01.103 with certain serial numbers have had incorrect heat treatment during manufacture. Components in this condition can decrease the specified fatigue life of the actuators.

In order to correct the condition described, this Airworthiness Directive (AD) requires an inspection to determine the serial number of the main landing gear actuator and replacement of certain main landing gear actuators with improved parts.

3. COMPLIANCE / ACTION:

Required as indicated below, unless already accomplished:

Prior to the accumulation of 1000 hours time-in-service (TIS) on the MLG- actuators, but not later than 12 months after the effective date of this AD:

3.1. INSPECTION / REPACEMENT

- 3.1.1. Do an inspection of the left and right MLG-actuators P/N 960.30.01.103 to determine the component serial number.
- 3.1.2. If during the inspection required by paragraph 3.1.1 any MLG-actuators P/N 960.30.01.103, with S/Ns 830E thru 881E inclusive is found; replace the MLG-actuator with a MLG-actuator which has a S/N other than 830E thru 881E.

4. PARTS INSTALLATION:

4.1. As of the effective date of this AD, no person shall install any main landing gear actuator P/N: 960.30.01.103, with S/Ns 830E thru 881E inclusive, on any Model Pilatus PC-12 Series airplane.

Rechtsmittelbelehrung siehe TM Nr. Voies de droit voir CT no. Rimedi giuridici vedi CT no. Right to appeal see CT no.	02.020-80	Seite Page Pagina Page	von de di of	2
---	-----------	---------------------------------	-----------------------	---

FOCA AD

HB-2004-330

Lufttüchtigkeitsanweisung (LTA) Consigne de Navigabilité (CN) Prescrizione di Aeronavigabilità (PA) Airworthiness Directive (AD)



BAZL Schweiz OFAC Suisse UFAC Svizzera FOCA Switzerland

5. REF. PUBLICATIONS:

The actions required by this AD shall be done in accordance with the manufacturer's documentation listed in this paragraph, and/or later revisions approved by the Swiss Federal Office for Civil Aviation (FOCA):

Manufacturer's Documentation

PILATUS PC-12 Service Bulletin No. 32-017, dated 03 August 2004

The applicable manufacturer's documentation may be obtained directly from:

PILATUS AIRCRAFT LTD.

TEL No.: +41 41 619 6208 FAX No.: +41 41 619 7311

CH-6371 STANS, Switzerland

Email: SupportPC12@pilatus-aircraft.com CUSTOMER SUPPORT MANAGER

6. FOR FURTHER INFORMATION CONTACT:

FEDERAL OFFICE FOR CIVIL AVIATION (FOCA)

Type Certification (MZ)

Maulbeerstrasse 9

FAX No.: +41 31 325 9324 (or)

CH-3003 Berne, Switzerland

FAX No.: +41 31 322 5918